MAIN GALLEY - POTWASH AREA

# **DETAILS OF INSPECTION VIOLATIONS**

NO.	LOCATION	REF.	POINTS	CRITICAL	DESCRIPTION
1	POTABLE WATER	80	0	No	
LAUNE	WATTS SERIES 7 BACKFLOW PREVENTION DEVICES WERE INSTALLED ON POTABLE WATER LINES SUPPLYING WAREWASH UNITS, LAUNDRY MACHINES, DECK TAPS, AND OTHER CONNECTIONS				
CORRE A shor	ECTIVE ACTION  e Backflow specialist hired and looking on the correct devices to replace S series 7 Back flow prevention devices.				
1	MAIN GALLEY - DINING ROOM	21	1	No	
THE FO	DRMICA COUNTERTOP AT THE WAIT STATIONS WAS CHIPPED. THERE IS A GAP BE DNS.	TWEEN '	THE TOP LEDO	GES AT THE CE	NTER WAIT
	ECTIVE ACTION: can not be properly repaired will be replaced during dry dock.				
2	MAIN GALLEY - HOT LINE	26	0	Yes	
THE HE	EATING ELEMENTS OF TWO OF THE DEEP FAT FRYERS WERE SOILED WITH FOOD I	DEBRIS.			
CORRE	ECTIVE ACTION:				
The fo	od debris was cleaned.				
2	POTABLE WATER	80	0	No	
THERE	TERNATIONAL SHORE CONNECTION LINE WAS FITTED WITH A REDUCED PRESSUR WAS THE POSSIBILITY OF CIRCUMVENTING THE DEVICE IF THE HOSE TO THE SHO TATION CONNECTION THAT WAS LESS THAN 2 FEET FROM THE SHORE CONNECTI	ORE POT			
	ECTIVE ACTION se connection moved futher away , and clearly Marked to avoid any circumventing	ng.			
3	MAIN GALLEY - FOOD SERVICE GENERAL	33	1	No	
	WERE GAPS AND OPEN SEAMS NOTED IN THE BULKHEADS AND DECKHEADS IN SCE AREAS.	SEVERAL	LOCATIONS	THROUGHOUT	THE FOOD
Deck h	ECTIVE ACTION: eads and bulkheads have been recently renewed and profile strips have been provid where necessary.	ded. We v	vill fill any sear	ns with NSF sea	alant or provide profile
3	CARBONATION UNITS	26	0	Yes	
BRASS ALL OF THE BA		ENTION D	DEVICES AND	THE CARBONA	TORS AT
	ECTIVE ACTION staller (COCA COLA) has been advised to correct it				
4	MAIN GALLEY - DINING ROOM	27	0	No	
FOOD	DEBRIS WAS NOTED ON THE BOTTOM OF THE PLATE HOLDING WELL.				
CORRE	ECTIVE ACTION:				
The fo	od debris was cloned.				
4	MEDICAL	01	0	Yes	
FOR THE 6/13-6/16 AND THE 6/16-6/18 CRUISES THE 24-HOUR PRIOR TO ARRIVAL REPORTES WERE MADE LESS THAN 24 HOURS PRIOR					
TO ARRIVAL IN THE U.S. FROM A FOREIGN PORT. THE DOCTOR STATED THAT THE SATELITE SYSTEM WAS DOWN AND THE REPORTS COULD NOT BE FAXED OR PHONED IN. THE REPORTS WERE MADE VIA E-MAIL, AND ON TIME FOR THE 6/18-6/20 AND 6/20-6/23 CRUISES.					
	ECTIVE ACTION:	IL 0/10-0/	-20 AND 0/20-	0,20 OKOIOLO.	
All the	24-hours prior arrival reports are now submmitted on time				

26

0

Yes

THE COLUMN FOR UNDERLYING ILLNESS WAS MISSING FROM THE STANDARDIZED GASTROINTESTINAL ILLNESS LOG.						
CORRI	ECTIVE ACTION:					
The co	The column has now been addded					
6	MAIN GALLEY - HOT KITCHEN	15	5	Yes		
	THREE LARGE CANS OF IMPERIAL TOMATO PASTE SEVERELY DENTED ON NON-SEAM AREA. CANS WERE ALSO DENTED ALONG THE SEAMS.					
TWO (02) LARGE CANS OF HANOVER KIDNEY BEANS WERE FOUND DENTED ON SEAM AND/OR RUSTING.						
ONE (C	01) LARGE CAN OF ARREZZIO MARINARA SAUCE SEVERELY DENTED.					
ONE (01) LARGE CAN OF ARREZZIO MUSHROOM PIECES/STEMS PARTIALLY OPENED AND STORED IN UNDERCOUNTER CABINET. ACCORDING TO GALLEY STAFF, IT WAS NOT KNOWN HOW LONG THE CAN HAD BEEN OPEN AND STORED IN THE CABINET. THIS CAN WAS DISPOSED OF DURING THE INSPECTION.						
CORRECTIVE ACTION: All cans were disposed. The policy has been implemented to resolve this practice.						
6	MEDICAL	11	0	Yes		
ON 6/16 A WAITRESS REPORTED TO THE MEDICAL OFFICE WITH GASTROINTESTINAL ILLNESS. THE WAITRESS WAS TAKEN OFF OF DUTY. THE						
WAITRESS RETURNED TO WORK WITHOUT A WRITTEN CLEARANCE TO DO SO.						
	ECTIVE ACTION: orrect policy has now been implemended.					

02

0

No

THREE PANS HAD RESIDUE FROM LABELS. A FEW COOKING UTENSILS WERE SOILED AND STORED AS CLEAN.

CORRECTIVE ACTION:

5 **MEDICAL** 

The labels were removed and cleaned.

Page 1 of 4DRAFT COPY

Signs were provided and posted.

# **DETAILS OF INSPECTION VIOLATIONS**

NO.	LOCATION	REF.	POINTS	CRITICAL DES	CRIPTION
7	MAIN GALLEY - HOT KITCHEN	27	0	No	
	OOD CONTACT AREAS OF DEEPT FAT FRYERS WAS SOILED WITH GREASE AND F OUSLY CLEANED.	OOD DEI	BRIS. THE DE	EP FAT FRYERS HAD	BEEN
	ECTIVE ACTION: e and food debris was cleaned.				
7	POOL	10	0	No	
	RAIN COVER FOR THE POOL WAS ANTI-VORTEX IN DESIGN AT A MAXIMUM FLOW NER WAS CONNECTED IN THE CENTER OF THE COVER.	RATE OF	108 GALLON	S PER MINUTE. ONL'	Y ONE
	ECTIVE ACTION isting 108 GPM anti-vortex device replaced with a correct size 400 GPM device	е			
8	MAIN GALLEY - HOT KITCHEN	27	0	No	
THE U	NDERSIDE OF THE GRILLS (AREA ABOVE THE DRAIN PAN) WAS SOILED WITH GRE	ASE AND	FOOD DEBR	IS	
CORR	ECTIVE ACTION:				
Greas	e and food debris was cleaned.				
8	BARS, BAR PANTRIES, AND PANTRIES GENERAL	33	1	No	
JUNCT	IEAD PENETRATIONS WERE NOTED THROUGHOUT THE BARS, BAR PANTRIES, AND URES NOT COVED.	ICE PAN	ITRIES. THE D	DECK-BULKHEAD	
	ECTIVE ACTION: ealant and profile strips will be added where necessary.				
9	BARS, AND BAR PANTRIES GENERAL	33	1	No	
ELECT	RICAL LINES, SUPPLY LINES, AND DRAINAGE LINES DRAPED THE DECK MAKING CI	LEANING	DIFFICULT		
CORR	ECTIVE ACTION:				
All sup	ply lines and drainage lines will be covered and protected.				
9	MASIN GALLEY - DISHWASH AREA	08	0	No	
THE HANDWASH SINK ADJACENT TO THE DISHWASH AREA HAD A HOSE ATTACHED TO THE UTILITY LINE. THERE WAS NO BACKFLOW PREVENTER ON THIS LINE. THE HOT AND COLD WATER SUPPLY LINES DID NOT HAVE BACKFLOW PREVENTERS INSTALLED, ONLY WATTS NO. 7 DUAL CHECK VALVES.					
CORRI See P	ECTIVE ACTION ara 1				
10	FOOD SERVICE GENERAL	30	0	No	
NONE	OF THE HAND WASH SINKS HAD SIGNS INDICATING TO "WASH HANDS OFTEN"				
CORR	ECTIVE ACTION:				
"Wash	Hands Often" signs provided.				
10	BARS GENERAL	21	1	No	
NOTED BETWI	WERE NOTED BETWEEN PIECES OF EQUIPMENT AND BETWEEN PIECES OF EQUIPM ) EEN SHEVLING UNITS AND THE DECKHEADS AND BULKHEADS. ACK SECTIONS UNDER THE BAR COUNTERS WERE CONSTRUCTED OF POROUS MA				N.
WIRES	AND LINES DRAPED THE COUNTERS MAKING CLEANING DIFFICULT.				
CORRECTIVE ACTION:  Deck and bulkheads will be removed and profile strips will be provided. We will protect and cover all wires and lines draped.					
11	BARS GENERAL	30	0	No	
"WASH	HANDS OFTEN" WERE NOT POSTED OVER THE HANDWASH SINK.				
CORR	ECTIVE ACTION:				

CORI	RECTIVE ACTION:			
Glass	ses and dishes were removed and cleaned.			
12	MAIN GALLEY - DISHWASH AREA	24	3	Yes
THE (	THE CONVEYOR DISHWASHER FINAL RINSE TEMPERATURE WAS MEASURED SEVERAL TIMES AT 154-158 DEGREES F. HEAT SENSITIVE			
ALSO DID NOT REGISTER ADEQUATE FINAL RINSE TEMPERATURES. THE DISHWASHER WAS IN ACTIVE USE AT THE TIME OF THE INSPECTION. THIS ITEM WAS CORRECTED DURING THE INSPECTION.				TIME OF THE
	RECTIVE ACTION: was corrected during inspection. Since then the temperatures been closely monitored.			
12	BARS GENERAL	22	2	No
THE \	WAREWASH UNITS WERE POSTED OUT OF ORDER.			
CORI	RECTIVE ACTION:			
Ware	wash unit was repaired.			
13	MAIN GALLEY - COLD LARDER	19	0	No
A FOUR INCH PAN ON LETTUCE WAS FOUND IN THE REACH-IN REFRIGERATOR WITH ICE, BUT THE PAN DID NOT ALLOW FOR THE WATER TO DRAIN FROM THE FOOD.				
	RECTIVE ACTION: can of lettuce was removed and proper procedures were implemented.			
14	POOL AND CALYPSO BAR STORE ROOM	38	0	No
A VEI	NT WAS NOT PROVIDED ON THE CLEANING LOCKER USED TO STORE WET MOPS.			
CORF	RECTIVE ACTION:			
A ver	nt opening was made on the cleaning locker door			

26

Yes

11 MAIN GALLEY - DISHWASH AREA

A FEW DISHES AND GLASSES WERE SOILED AND STORED AS CLEAN.

Page 2 of 4DRAFT COPY

# **DETAILS OF INSPECTION VIOLATIONS**

NO. LOCATION	REF.	POINTS	CRITICAL DESCRIPTION	
14 MAIN GALLEY - DISHWASH AREA	24	3	Yes	
THE FINAL RINSE TEMPERATURE OF THE GLASSWASHER WAS TESTED AT BELOW 16	60 DEGREES	F AT THE GL	ASS SURFACE. THE UNIT	
WAS IN ACTIVE USE AT THE TIME OF THE INSPECTION. THE UNIT WAS PLACED OUT OF ORDI	ER.			
CORRECTIVE ACTION: The machines were repaired.				
14 BARS GENERAL	36	0	No	
THE NEWLY INSTALLED LIGHT BULBS WERE NOT SHIELDED OR SHATTER-RESISTANT	Г.			
CORRECTIVE ACTION:				
Protective shields will be installed.				
15 MAIN GALLEY - ICE MACHINE	20	2	No	
GAPS WERE NOTED BETWEEN THE ICE CUBER AND THE BOTTOM ICE BIN RENDERING	G THE SURF	ACES NOT EA	SILY CLEANABLE.	
CORRECTIVE ACTION:				
Gaps will be sealed.				
15 ROTUNDA BAR-SODA ROOM	33	1	No	
THE DECK FINISH WAS WORN AND ROUGH IN THE SODA ROOM.				
CORRECTIVE ACTION:				
The deck resurfaced.				
16 ROTUNDA BAR	19	0	No	
THE LOCATION OF THE SOAP DISPENSER WAS ACROSS FROM THE ICE MACHINE. THE ICE FROM WATER DRIPPING FROM HANDS.	HIS LOCATIO	N COULD CA	USE CONTAMINATION OF	
CORRECTIVE ACTION:				
The soap dispenser was relocated and corrected.				
16 MAIN GALLEY - DINING ROOM	16	0	Yes	
NO CONSUMER ADVISORY NOTICE IS PROVIDED TO PASSENGERS WHEN POTENTIAL	LY HAZARD	OUS FOODS	ARE PREPARED TO LESS	
THAN RECOMMENDED TEMPERATURES. ACCORDING TO GALLEY STAFF, AT LEAST ONE D UNDERCOOKED.	DINNER MEAL	ALLOWS FC	R FOODS TO BE	
CORRECTIVE ACTION: Consume advisory notice will be printed in the menu.				
17 PROVISIONS - GENERAL	33	1	No	
SEVERAL GAPS, OPENS SEAMS, AND HOLES WERE NOTED IN FOOD STORAGE ARE.		RESHOLDS T		
REFRIGERATION UNITS AND FOOD STORAGE AREAS HAD SECTIONS THAT WERE HARD TO CLEAN DUE TO GAPS AND MISSING FLOORING MATERIALS.				
CORRECTIVE ACTION: Gaps, Open Seams and Holes will be sealed as much as possible.				
17 ROTUNDA BAR	30	0	No	
A TOILET TISSUE DISPENSER AND TOILET TISSUES WERE PROVIDED RATHER THAN A PAPER TOWEL DISPENSER AND PAPER TOWELS.				
CORRECTIVE ACTION:				
Paper towel dispenser was provided and installed.				
18PROVISIONS - VEGETABLE PREPARATION AREA	19	0	No	
THREE KEGS OF BEER WERE STORED DIRECTLY ON THE DECK.				
CORRECTIVE ACTION:				
Corrected during inspection and policy in placed.				
18 ROTUNDA BAR	21	1	No	

THE PROTECTIVE PLASTIC SHEETING ON THE STAINLESS STEEL SURFACES OF THE REFRIGERATION UNIT TECHNICAL COMPARTMENT WAS CURLED AND DIFFICULT TO CLEAN. **CORRECTIVE ACTION:** Plastic sheeting will be removed and replaced. 19 ROTUNDA BAR 19 No CANS OF SODA AND BEER WERE STORED UNDER THE DRAIN LINES OF THE HAND SINK AND DUMP SINK. **CORRECTIVE ACTION:** Removed and stored in assigned lockers. Policy in placed. FOOD SERVICE GENERAL 22 2 No NONE OF THE WAREWASH MACHINES HAD DATAPLATES. **CORRECTIVE ACTION:** Data plates requested from the manufacturer. 20 OFFICER'S PANTRY 24 3 Yes THE IN-USE GLASSWASH MACHINE FINAL RINSE TEMPERATURE WAS MEASURED AT 150 DEGREES F AT THE GLASS SURFACE. THIS ITEM WAS CORRECTED DURING THE INSPECTION. **CORRECTIVE ACTION:** 

Corrected during inspection, Policy in placed to monitor the temperatures very closely.

10 0 No

A REVIEW OF THE FECAL ACCIDENT PROCEDURE NOTED 10 PPM TO BE USED FOR 2 HOURS IN THE EVENT OF AN ACCIDENT INVOLVING DIARRHEA.

CORRECTIVE ACTION

Procedure corrected to 80 ppm for 2 hours.

Page 3 of 4DRAFT COPY

# MIRAGE 6/23/2003

## **DETAILS OF INSPECTION VIOLATIONS**

# NO. LOCATION REF. POINTS CRITICAL DESCRIPTION

#### 21 CORRECTIVE ACTION STATEMENT

IN DEVELOPING THE CORRECTIVE ACTION STATEMENT FOR THIS INSPECTION, CRITICAL-ITEM DEFICIENCIES (DESIGNATED WITH YES IN CRITICAL COLUMN (WORTH 3 - 5 POINTS), WHETHER DEBITED OR NOT, SHOULD INCLUDE STANDARD OPERATING PROCEDURES AND MONITORING PROCEDURES IMPLEMENTED TO PREVENT THE RECURRENCE OF THE CRITICAL DEFICIENCY.

PREPARE CORRECTIVE ACTION STATEMENT AS A WORD PROCESSING OR SPREADSHEET FILE WHICH WILL BE SENT TO USPHS / VSP AS AN

EMAIL MESSAGE ATTACHMENT. PLEASE EMAIL CORRECTIVE ACTION STATEMENT TO: VSP@CDC.GOV

USE EMAIL MESSAGE SUBJECT LINE: MIRAGE I - CAS - [0623/2003].

## 21 OFFICER'S PANTRY

22 2 No

0

No

CHLORINE TEST STRIPS WERE NOT AVAILABLE TO MEASURE THE CHLORINE CONCENTRATION OF THE SANITIZER IN THE 3-BUCKET SYSTEM.

PERSONNEL ASSIGNED TO THIS AREA WERE NOT FAMILIAR WITH TESTING CHLORINE CONCENTRATION OF THIS SYSTEM.

### **CORRECTIVE ACTION:**

Test strips were provided and training program was implemented.

#### 22 INTEGRATED PEST MANAGEMENT

40 0 No

THERE WAS NO DOCUMENTATION OF PEST CONTROL EMPLOYEE TRAINING.

### **CORRECTIVE ACTION:**

Crew training program was scheduled and will be documented.